




Example

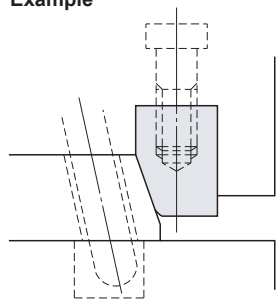


A = 15 ~ 23

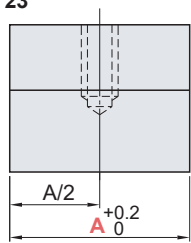

A = 28 ~ 98

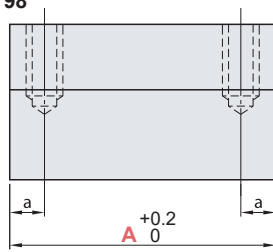

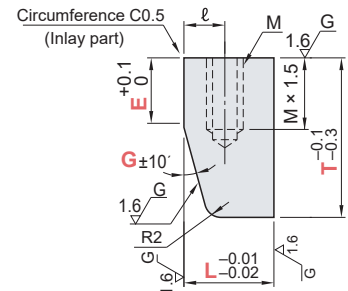

Part Number	Ⓜ	Ⓜ
LBMS	SKS3	53 ~ 56HRC
LBMM	HPM2T equivalent	37 ~ 41HRC
LBMD	SKD61	50 ~ 55HRC

a	ℓ	M	Part Number		T	A	E	G°
			TYPE	L				
7	7	6	LBMS	SKS3	20	15 18 23 28 33 38 48	10 ~ 13	5 ~ 33
					25		10 ~ 15	5 ~ 33
					30		10 ~ 20	5 ~ 33
					35		10 ~ 25	5 ~ 28
					40		10 ~ 30	5 ~ 22
8	9	8	LBMM	HPM2T equivalent	30	33 38 48 58	10 ~ 20	5 ~ 33
					35		10 ~ 25	5 ~ 33
					40		10 ~ 30	5 ~ 30
					50		12 ~ 40	5 ~ 24
10	12	10	LBMD	SKD61	35	38 48 58 68 78	12 ~ 25	5 ~ 33
					40		12 ~ 30	5 ~ 33
					50		12 ~ 40	5 ~ 30
12	14	12	LBMD	SKD61	40	78 88 98	12 ~ 30	5 ~ 33
					50		12 ~ 40	5 ~ 33
					60		12 ~ 50	5 ~ 30



Order Example

TYPE	T	A	E	G
LBMS20	- 30	- A38	- E10	- G15